

Landlords / Homeowner Gas Safety Record - G2

Access Date: Friday, 15 May, 2020
 Next expiry date: Tuesday, 18 May, 2021

Cert. No: CT-1151359-1522708001



Gas-elec Group
 Summer Road,
 Walsham - Le - Willows,
 Bury St Edmunds,
 IP31 3AJ



Client:


Site Add.:

Gas Inspection Details

Meter Reading	Meter / ECV Location	AECV location (if app)	Meter Visual Inspection	Meter Type	ECV Accessible	Gas Installation Pipework	Let-By/Tightness Test	Record Pressure Drop	Protective Earth Bond
03129	Kitchen Cupboard	N/A	Pass	SMART	Yes	Pass	Pass / Pass	0	Yes

Gas Appliance Details

	Fire/Back Boiler	Hob	Boiler/Combi
Location	Living Room	Kitchen	Kitchen Compartment
Make	Baxi	Whirlpool	Vaillant
Model #	Bermuda	AKM200/WH	ecoTec pro28 VUV GB 286/5-3 R2
Serial #	-	49AR2014	21133200 100116901 30056095N4
Flue Type	Open Flued	Flueless	Room Sealed
Safety Device	N/C	N/P	Pass
Operating Pressure/Gas Rate	N/C	6.00 W (NETT)	6.00 W (NETT)
Ventilation Adequate	N/C	Pass	Pass
Flue Flow Test	N/C	N/A	N/A
Spillage Test	N/C	N/A	N/A
Termination Satisfactory	N/C	N/A	Yes
Visual Condition	N/C	Pass	Pass
Appliance Serviced	No	No	Yes
ID, AR or Advisory situation	N/A	N/A	N/A
Gas Council Number	N/A	N/A	47-044-45
Flue Gas Analysis (Ratio)	N/A - This appliance is not a boiler	N/A - This appliance is not a boiler	0.0007
Safe To Use	N/C	Yes	Yes
Appliance related comments:	The appliance previously disconnected / isolated from gas supply - unable to verify the point of disconnection. No inspection carried out	The hob burners do not have thermocouple safety devices (FSD), now a requirement for all hobs in flats - not to current standards.	No engineer comment

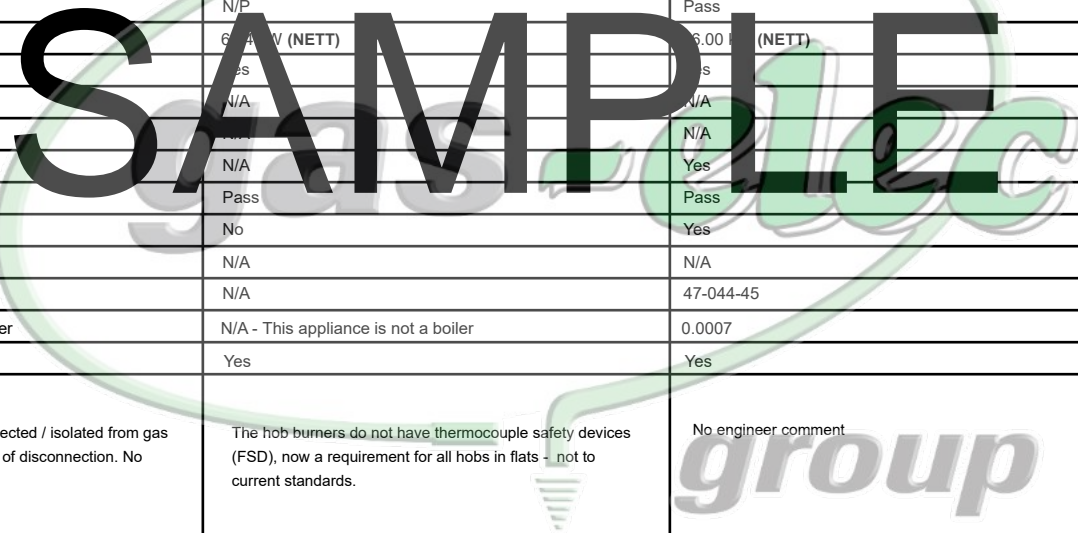

In the event of a complaint relating to any service or installation in a property gas-elec must be given the opportunity to address the issue by re-visiting the property to resolve any alleged complaint. gas-elec cannot be held responsible if the opportunity to fully address the matter is not afforded to us. In the event of another company/contractor being called to the property to investigate or attempt to rectify an alleged complaint in preference to gas-elec the company will accept no liability. A detailed internal inspection of the flue integrity, construction and lining has not been carried out. I confirm that the situation(s) recorded above, has been identified and brought to the attention of the Responsible Person in

This report has been produced in accordance with the Gas-Elec Group working method statement which covers COVID -19 virus procedures. A copy of this working method statement can be found on: www.gas-elec.co.uk/cvd19

This Safety Record Issued By

Name

Next Inspection Due Within 12 Months

(Please refer to 'General Comments' page for comments made by the engineer regarding the installation)

Landlords / Homeowner Gas Safety Record - G2

Access Date: Friday, 15 May, 2020
Next expiry date: Tuesday, 18 May, 2021

Cert. No : CT-1151359-1522708001



Gas-elec Group
Summer Road,
Walsham - Le - Willows,
Bury St Edmunds,
IP31 3AJ



Client:

Site Add.:

General comments:

The boiler is sited in the kitchen compartment. The flue is a concentric flue system. The flue rises vertically passing through the ceiling into the loft and roof to outside. The flue assembly in the loft has two support bracket fitted.

The carbon monoxide alarm was function tested and is working - expires Jun 2020.

SAMPLE

group

Annual Electrical Safety Record - E2



Gas-elec Group
 Summer Road,
 Walsham - Le - Willows,
 Bury St Edmunds,
 IP31 3AJ

Access Date: Friday, 15 May, 2020
 Next expiry date: Tuesday, 18 May, 2021

Cert. No: CT-1151359-1522708001

Client:

Site Add.:

INSTALLATION INSPECTION (Visual & Functional)

Electrical supply details		Meter Reading: 5,554
Type : TN-C-S	PIR/EICR Label present No	Meter Visual Inspection: Pass
Main Earthing Conductor	Main Protective Bonding Conductors	General Condition of Consumer Unit: Fair
Present	Water : LIM Gas : Yes Other :	Consumer Unit Location: Hallway cupboard
		RCD Test: No
		RCD Operating times
		X1: 0.0 X5: 0.0
		Zs 0.80 Ω

Circuit Number	Description	Functional Check	Protective Device	Recommendations
1	No Identification	No	BS1361 0.4s	15A
2	Heating	No	BS1361 0.4s	5A
3	Lighting throughout	No	BS1361 0.4s	5A
4	Lighting throughout	No	BS1361 0.4s	5A
5	Immersion heater	No	BS1361 0.4s	15A
6	Socket outlets Kitchen	No	BS1361 0.4s	5A
7	Socket outlets Throughout	No	BS1361 0.4s	5A

APPLIANCE DETAILS/ ELECTRICAL EQUIPMENT RESULTS

ID	Location	Type	Make	Model	Serial No	P	Flex	Body	Continuity (ohms)	Insulation (megohms)	Functional Check	Comments	Passed Safety Test
1	Kitchen	Cooker Hood	Ignis	AKF420WH/1	509527006786	Pass	Pass	Pass	N/A	20.0	Pass	Double Insulated	Yes
2	Kitchen	Oven	Whirlpool	AKP526/WH	140305028975	Pass	Pass	Pass	0.12	20.0	Pass	Class 1	Yes
3	Kitchen	Hob Ignition	Whirlpool	AKM200/WH	49AR2014	Pass	Pass	Pass	0.07	20.0	Fail	Class 1	Yes
4	Bathroom	Shower	Triton	Alicante	Not Found	N/A	N/Acc	Pass	N/A	N/C*	Pass	Normal Visual Inspection	Yes

Details of any faults found and rectification work necessary

Warning Notice

1	The filter cover is missing.	No	This Safety Record Issued By: Engineer Name:
2	The oven door seal need replacing.	No	
3	The ignition generator is faulty, however, the hob is still safe to use.	No	
4		No	

Next Inspection Due Within 12 Months

The report is a general, visual, surface and functional examination of the electrical system, which is accessible i.e. visible and readily available for inspection from ground and floor levels without risk of causing damage to the property or injury to the inspector and limited accordingly. Due care is therefore exercised throughout the inspection regarding safety, practicality and the constraints of being a visitor to the property (which may be occupied). So furniture, floor coverings and other contents are not moved, lifted and no part is forced or laid open to make it accessible. Loop impedance tests are only carried out on socket outlets. The report is provided solely for the use of the client and no liability to anyone else is accepted. Should the client not act upon specific advice contained in the report, no responsibility is accepted for the consequences. Gas-elec Safety (UK) Ltd, its employees or franchisees accept no liability for the consequences of any errors or omissions in this report. **THIS IS A VISUAL AND FUNCTIONAL INSPECTION ONLY.** In the event of a complaint relating to any service or installation in a property gas-elec must be given the opportunity to address the issue by re-visiting the property to resolve any alleged complaint. gas-elec cannot be held responsible if the opportunity to fully address the matter is not afforded to us. In the event of another company/contractor being called to the property to investigate or attempt to rectify an alleged complaint in preference to gas-elec the company will accept no liability. Where passed safety test is VO, this is an abbreviation of visual only inspection. **This report has been produced in accordance with the Gas-Elec Group working method statement which covers COVID -19 virus procedures. A copy of this working method statement can be found on: www.gas-elec.co.uk/cvd19**

Annual Electrical Safety Record - E2



Gas-elec Group
 Summer Road,
 Walsham - Le - Willows,
 Bury St Edmunds,
 IP31 3AJ

Access Date: Friday, 15 May, 2020
 Next expiry date: Tuesday, 18 May, 2021

Cert. No: CT-1151359-1522708001

Client:

Site Add.:

INSTALLATION INSPECTION (Visual & Functional)

Electrical supply details		Meter Reading: 5,554
Type : TN-C-S	PIR/EICR Label present No	Meter Visual Inspection: Pass
Main Earthing Conductor	Main Protective Bonding Conductors	General Condition of Consumer Unit: Fair
Present	Water : LIM Gas : Yes Other :	Consumer Unit Location: Hallway cupboard
		RCD Test: No
		RCD Operating times
		X1: 0.0 X5: 0.0
		Zs 0.80 Ω

Circuit Number	Description	Functional Check	Protective Device	Recommendations
8	Cooker point	No	BS1361 0.4s	30A
9	Shower	No	BS (EN) 60898	B40 (seperate fuseboard)

APPLIANCE DETAILS/ ELECTRICAL EQUIPMENT RESULTS

ID	Location	Type	Make	Model	Serial No	Plug	Fle	Body	Continuity (ohms)	Insulation (megohms)	Functional Check	Comments	Passed Safety Test
----	----------	------	------	-------	-----------	------	-----	------	-------------------	----------------------	------------------	----------	--------------------



Details of any faults found and rectification work necessary

Warning Notice

This Safety Record Issued By:

Engineer Name:

Next Inspection Due Within 12 Months

*(Please refer to the documents titled "E2 comments" for comments made by the engineer for this inspection)

The report is a general, visual, surface and functional examination of the electrical system, which is accessible i.e. visible and readily available for inspection from ground and floor levels without risk of causing damage to the property or injury to the inspector and limited accordingly. Due care is therefore exercised throughout the inspection regarding safety, practicality and the constraints of being a visitor to the property (which may be occupied). So furniture, floor coverings and other contents are not moved, lifted and no part is forced or laid open to make it accessible. Loop impedance tests are only carried out on socket outlets. The report is provided solely for the use of the client and no liability to anyone else is accepted. Should the client not act upon specific advice contained in the report, no responsibility is accepted for the consequences. Gas-elec Safety (UK) Ltd, its employees or franchisees accept no liability for the consequences of any errors or omissions in this report. **THIS IS A VISUAL AND FUNCTIONAL INSPECTION ONLY.** In the event of a complaint relating to any service or installation in a property gas-elec must be given the opportunity to address the issue by re-visiting the property to resolve any alleged complaint. gas-elec cannot be held responsible if the opportunity to fully address the matter is not afforded to us. In the event of another company/contractor being called to the property to investigate or attempt to rectify an alleged complaint in preference to gas-elec the company will accept no liability. Where passed safety test is VO, this is an abbreviation of visual only inspection. [This report has been produced in accordance with the Gas-Elec Group working method statement which covers COVID -19 virus procedures. A copy of this working method statement can be found on: www.gas-elec.co.uk/cvd19](http://www.gas-elec.co.uk/cvd19)

Appliance Service Record

Date: Friday, 15 May, 2020

Cert. No: RP-1151359-1522708001



Gas-elec Group
Summer Road,
Walsham - Le -
Willows,
Bury St Edmunds,
IP31 3AJ



Client:

Site Add:

APPLIANCE

Location/Position	Type	Type of Boiler	Make	Model	Flue Type	Serial No.	Gas Council Number	Approx. age
Kitchen Compartment	Boiler/Combi	Combi Boiler	Vaillant	ecoTec pro28 VUW GB	Room Sealed	21133200 100116901 30	47-044-45	6

APPLIANCE CHECKLIST	Result	Rectification work necessary / completed
Stability	Pass	
Controls	Pass	
Electrics	Pass	
Pipework	Pass	
Location	Pass	
Gaskets/Seals	Pass	Replaced burner door seal.
Gas Connections	Pass	
Burner/Injectors	Pass	Cleaned
Leaks Gas/Water	Pass	
Casing	Pass	
Ignition	Pass	
Heat Exchanger	Pass	
Fan Assembly	Pass	
Flame Picture	N/A	
Return air (warm air only)	N/A	
Fireplace/Catchment	N/A	
Overflow/Discharge	Pass	Condensate waste pump fitted.
Closure Plate	N/A	
Appliance water flow rate and temperature	Pass	
Additional checks completed		


SAFETY TESTS	Faults found and rectification work	
Safety Device satisfactory?	Yes	
Ventilation satisfactory?	Yes	
Flue flow test satisfactory?	N/A	
Spillage test satisfactory?	N/A	
Flue termination satisfactory?	Yes	
Visual check satisfactory?	Yes	
Tightness test satisfactory?	Yes	
Operating pressure / gas rate satisfactory?	Yes	
Operating pressure / gas rate reading	26.00 kW (NETT)	
Installation safe to use?	Yes	
Appliance safe to use?	Yes	

FGA (Flue Gas Analysis) READINGS	
CO (PPM):	64
CO2 (%):	9.1
CO/CO2 Ratio:	0.0007

Engineer Comments
The condensate waste pipe is preventing the removal of the condensate sump for cleaning.
The central heating timer selector switch on the boiler is missing/broken off.

In the event of a complaint relating to any service or installation in a property gas-elec must be given the opportunity to address the issue by re-visiting the property to resolve any alleged complaint. gas-elec cannot be held responsible if the opportunity to fully address the matter is not afforded to us. In the event of another company/contractor being called to the property to investigate or attempt to rectify an alleged complaint in preference to gas-elec the company will accept no liability. A detailed internal inspection of the flue integrity, construction and lining has not been carried out. I confirm that the situation(s) recorded above, has been identified and brought to the attention of the Responsible Person in accordance with the GSIUR, and Gas Industry Unsafe Situations Procedure. This report has been completed and issued by Gas-elec Safety (UK) Ltd.

Engineer name:
Engineer signature:



This report has been produced in accordance with the Gas-Elec Group working method statement which covers COVID -19 virus procedures.
A copy of this working method statement can be found on: www.gas-elec.co.uk/cvd19

E2 Comments



Gas-elec Group
Summer Road,
Walsham - Le - Willows,
Bury St Edmunds,
IP31 3AJ

Access Date: Friday, 15 May, 2020
Next expiry date : Tuesday, 18 May, 2021

Cert. No : CT-1151359-1522708001

Client :

Site Add. :


Observation

The fuseboard is an old cartridge circuit breaker consumer unit with no RCD protection. There is a second separate single fuse circuit breaker. The circuit details are as per the fuseboard labels but were not confirmed.

There is no EICR (Electrical Installation Condition Report) label to indicate when the last inspection was carried out - it should be inspected every 5 yearly, therefore I recommended for an EICR inspection.

The hallway battery smoke alarm was function tested and is working - expires Jul 2026.

Please note: - Landlords are required by law to install a working smoke alarm in the lounge, hallway and heat alarm in the kitchen. All alarms should be ceiling mounted and interlinked. For further information see www.gov.uk.

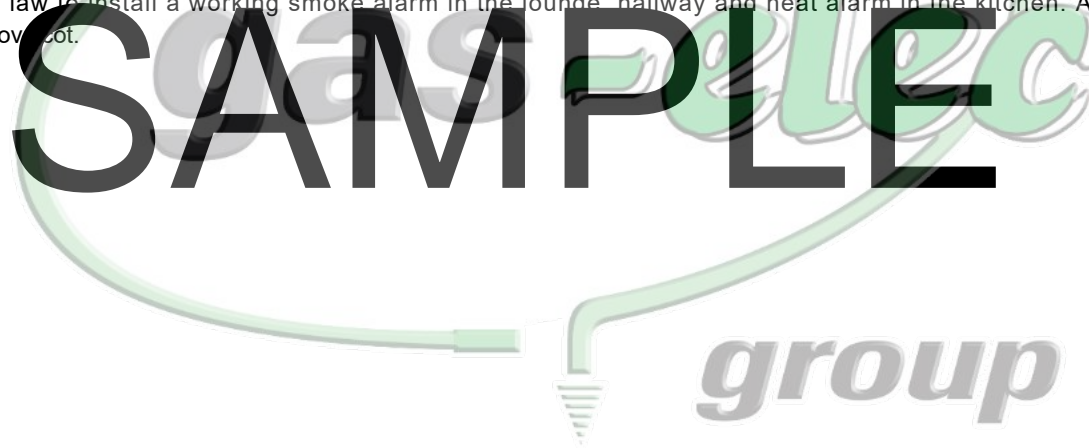

It has not been possible to carry out an insulation test on the Shower . The test result is based on the other tests being carried out and a formal visual inspection has been carried out on this appliance

The notes on this page relate to the safety inspection carried out at the above property. Consideration should be given to having those items remedied or investigated further

Accompanying Photos



Gas-elec Group
 Summer Road,
 Walsham - Le - Willows,
 Bury St Edmunds,
 IP31 3AJ 7PJ
 TEL : 0800 5879999

Job No.: 1522708

Date : 15/05/2020



Accompanying photos provided by the engineer

Description: CH timer plastic selector switch missing.



Description: Cooker hood filter panel missing.



SAMPLE

gas-elec

group

The results shown on this report reflect the situation at the time of the inspection. Gas-Elec, its employees and engineers cannot be held responsible for any failure of the boiler or heating system after the inspection.

The report is a general visual, surface and functional examination of the central heating and / or plumbing system without risk of causing damage to the property or injury to the inspector. Due care is therefore exercised throughout the inspection regarding safety, practically and the constraints of being a visitor to the property (which may be occupied). Furniture, floor coverings and the contents are not moved or lifted and no part is forced or laid open to make accessible. Gas-elec Safety (UK) Ltd. or it's employees accept no liability for the consequences of any errors or omissions on this report.

Inspector:

Inspector Signature: